NOTES: STONES, REALIGNING/RESETTING LOOSE LIMESTONE CAPS AND RESEALING THEIR JOINTS. EXISTING FLAG POLES TO REMAIN AS IS (TYP) AS CLOSELY AS POSSIBLE. WORKMANSHIP PRIOR TO PROCEEDING WITH THE ENTIRE PROJECT. └─ STONE WALL (FRONT & BACK), ASSUME 50% OF THE WALL NEEDS REPAIR WHICH INCLUDES BUT IS NOT LIMITED TO TUCKPOINTING LOOSE AND/OR CRACKED MORTAR JOINTS, RESETTING OR REPLACING LOOSE OR MISSING/BROKEN STONES, REALIGNING/RESETTING LOOSE LIMESTONE CAPS AND RESEALING THEIR JOINTS. PROJECT AREA – FLAG POLE MONUMENT WALL EXISTING MAIN FLAG POLE -(TO REMAIN AS IS) **EXAMPLE OF LIMESTONE CAP REQUIRE RESETTING AND JOINT RESEALING (REMOVE** OLD SEALANT) SITE PLAN - FLAG POLE MEMORIAL WALL SCALE: 1" = 10'-0" **EXAMPLE OF BROKEN STONE TO BE REPLACED, LIMESTONE CAP TO** BE RESET AND JOINT TO BE RESEALED (REMOVE OLD SEALANT) Drawing Title
SITE PLAN -FLAG POLE STONE WALL NATIONAL one inch = one hundred feet CEMETERY Approved: Division Chief **ADMINISTRATION** Approved: Service Director Date Revisions

1. EXISTING STONE WALL IS APPROX. 208 FEET LONG AND HAS A TYPICAL WIDTH OF APPROX. 1.5 FEET WIDE AT THE TOP BY 2 FEET WIDE AT THE BOTTOM, WITH A TYPICAL HEIGHT OF APPROX. 4 FEET ABOVE GRADE.

2. APPROX. 50% OF THE WALL (FRONT & BACK) NEEDS REPAIR WHICH INCLUDES BUT IS NOT LIMITED TO TUCKPOINTING LOOSE AND/OR CRACKED MORTAR JOINTS, RESETTING OR REPLACING LOOSE OR MISSING/BROKEN

3. CLEAN AND REUSE EXISTING STONES AS MUCH AS POSSIBLE. PROVIDE NEW MATCHING STONES AS NEEDED TO FULLY COMPLETE THE WALL REPAIR WORK BACK TO ORIGINAL CONDITION MATCHING ADJACENT UNDISTURBED


4. ALL NEW MORTAR FOR THIS WALL PROJECT SHALL HAVE THE COLOR MATCH WITH THE EXISTING AGED MORTAR

5. COMPLETE AN INITIAL TEST SECTION OF WALL TUCKPOINTING AND OBTAIN COR APPROVAL FOR COLOR AND

6. SURFACE FINISH TOOLING PATTERN OF ALL RETUCK POINTED JOINTS TO MATCH EXISTING SURFACE FINISH TOOLING PATTERN OF THE ADJACENT EXISTING AREAS OF THE MONUMENT STONE WALL. COMPLETED WORK TO VISUALLY MATCH AND BLEND WITH SURROUNDING MONUMENT STONE WALL IN COLOR AND TEXTURE AND PATTERN.



**REQUIRE JOINT RESEALING (REMOVE OLD SEALANT** 

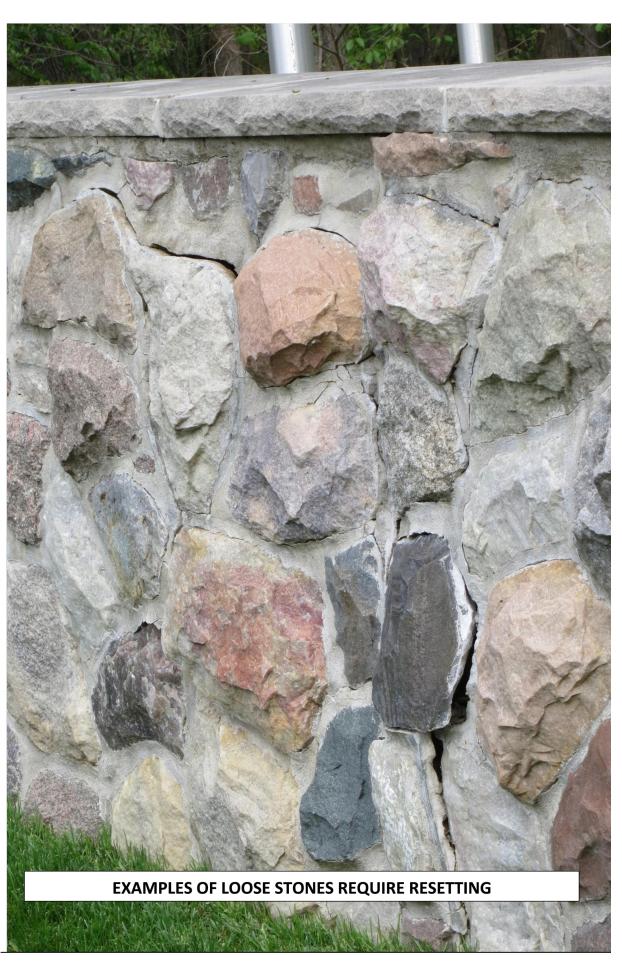

## FINAL FOR CONSTRUCTION

**JUNE 16, 2015** 

Project Title REPAIR PAVEMENT, STONE WALLS & WALKWAY

Building Number | Checked | Drawn Location

FORT CUSTER NATIONAL CEMETERY

DRAWING NO. Dwg. 3 Of 5

6/16/2015

774CM3915-002